

## Case 239 : Narrative

Case Vehicle (A): 2000 Mercedes-Benz	Veh. (B): 1990 Eagle
Type: C230, 4-door sedan	Type: Talon, 2-door hatchback
Driver: 42-year-old female	Driver: 29-year-old male
CDC: 12-FDEW-2, 09-LPEW-2	CDC: 99-0000-0

### SITUATION

[1](#) It was daylight, the skies were clear, and case vehicle (A) was traveling east at an unknown speed in the left eastbound lane [2](#) of a divided five-lane, asphalt road surface that was dry and free of defects. Vehicle (B) was traveling west at an unknown speed in the left westbound lane. At the intersection with a north-south road, vehicle (B) turned left in front of case vehicle (A). The driver of case vehicle (A) was reportedly unable to take any evasive maneuvers, or apply the brakes, and the front of case vehicle (A) struck the right side of vehicle (B) at the front fender. Case vehicle (A) rotated clockwise and vehicle (B) rotated counter clockwise, and the right rear of vehicle (B) struck the left-rear door of case vehicle (A). [3](#) Case vehicle (A) then moved to the right and came to rest facing southeast across the left northbound lane of the north-south road. [4](#) Vehicle (B) continued to the east and came to rest facing east in the right eastbound lane of the east-west road. The driver of case vehicle (A) was transported to a local hospital and was treated and released. The driver of vehicle (B) sustained type "B" injuries according to the Police Accident Report, but did not seek immediate medical attention. Both vehicles were towed from the scene.

### GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[5](#) Overall damage to case vehicle (A) was moderate. [6](#) Direct damage to case vehicle (A) from the first impact began at the left-front bumper corner and extended 125 cm to

the right headlight assembly, resulting in 78-percent vehicle overlap. The maximum crush from the first impact was 36 cm, which occurred at the left-front bumper corner. [7](#) Direct damage to case vehicle (A) from the second impact began 140-cm forward of the left-rear bumper corner below the left-rear door handle, and extended 66-cm forward to the front portion of the left-rear door. The maximum crush was 10 cm and occurred at the center of the left-rear door.

Using the WinSMASH accident-reconstruction program and a [8](#) [9](#) [10](#) [11](#) crush profile measured for case vehicle (A), the following impact severity was calculated for the first impact:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	EBS	28 (18)	-28 (-17)	5 (3)

Using the WinSMASH accident-reconstruction program and a [12](#) [13](#) crush profile measured for case vehicle (A), the following impact severity was calculated for the second impact:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	EBS	9 (6)	0 (0)	9 (6)

## DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

### Exterior

In the front, [14](#) [15](#) the left headlight assembly, the bumper, the grille, the fascia, and [16](#) the left portion of the engine compartment were crushed rearward. The hood latch was deformed, but it did not release and was not jammed closed. [13](#) Both hood hinges were

damaged, [17](#) and the rear edge of the hood was slightly elevated but it did not contact the windshield.

[18](#) On the left side, the fender was crushed rearward, [19](#) the rear door was crushed inward, the lower B-and C-pillars were damaged, the rear door was jammed closed, and the rear window was broken out. The left wheelbase was reduced 7 cm.

[20](#) The right fender was buckled, but there was no other right-side damage and [21](#) there was no significant change to the right wheelbase.

[22](#) There was no damage to the rear of the vehicle.

## Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, door-mounted side-impact airbags, and seatbelt pretensioners with belt-force limiters.

[23](#) Only the steering-wheel frontal-impact airbag deployed. The passenger-frontal impact airbag did *not* deploy because it is equipped with occupant sensors located in the seat that suppress the airbag if the seat is unoccupied. [24](#) There was no damage to the steering-wheel or [25](#) passenger airbag module covers/flaps. [26](#) There was no deflection of the steering-wheel rim or [27](#) the spokes. The metal steering-wheel emblem was severely deformed. There was no apparent horizontal or vertical displacement of the steering column. [28](#) The center and vertical consoles were knocked out of alignment. [29](#)

The glove box was damaged when salvage yard personnel attempted to pry it open after the crash. [30](#) The parking-brake pedal cover was knocked off. [31](#) The left-rear door window was broken out. [32](#) The plastic B-pillar cover was displaced. [33](#) [34](#) [35](#) [36](#) [37](#) [38](#) [39](#) There was no other interior damage and there were no measurable intrusions.

## OCCUPANT KINEMATICS AND INJURIES

[40](#) The 5-ft, 1-in, 180-lb, 42-year-old female driver was wearing the three-point belt and the [41](#) frontal-impact airbag deployed. It is unknown if the seatbelt pretensioner deployed. [42](#) Webbing imprints on the plastic D-ring and [43](#) continuous loop, and [44](#) plastic transferred onto the belt webbing, are indicators of belt use at the time of the crash. [45](#) The driver reportedly had the vehicle seat adjusted to the forward-most seat-track position and the seatback fairly upright, although it was slightly reclined at the time of the vehicle inspection. Also, she reportedly had the tilt steering-wheel in a mid-tilt position, and the telescoping steering-wheel positioned forward and close to the instrument panel.

On impact, the driver moved forward and to the left relative to the vehicle interior, into the belt restraint and airbag. She sustained cervical strain, probably due to impact forces (flexion and/or lateral bending), or possibly due to head contact by the airbag. She sustained a contusion to her left hip, probably due to contact with the interior of the left-front side-door, or possibly due to loading by the lap belt. She sustained a contusion and abrasion to her right knee due to contact with the knee bolster, [46](#) as evidenced by a scuff mark just below the steering column. She sustained a contusion to her right foot, probably due to contact with the side of the brake pedal, or possibly due to contact with the toepan.

The following table and attached drawing [47](#) summarize the injuries for the driver of case vehicle (A).

Occupant: Driver	Age: 42 years	Gender: Female		
Restraints: 3-point belt worn; unknown if pretensioner deployed; frontal-impact airbag deployed; side-impact airbag did <u>not</u> deploy	Stature: 155 cm (5 ft, 1 in)	Mass: 82 kg (180 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Cervical strain	1	—	Impact force	Airbag
Contusion, lateral aspect of the left hip	1	—	Side door interior	Lap belt restraint
Contusion and abrasion, medial aspect of the right knee	1	Knee bolster	—	—
Contusion, right foot	1	—	Brake pedal	Toe pan
Maximum A.I.S. Level	1	—	—	—
Injury Severity Score	2	—	—	—

CASE NO.: 239-01

CASE VEHICLE: 2000 Mercedes-Benz


TYPE: C230, 4-door sedan

OCCUPANT: Driver: 42-year-old female

STATURE: 155 cm (5 ft, 1 in) MASS: 82 kg (180 lb)

RESTRAINTS: 3-point belt worn; unknown if  
pre-tensioner deployed;  
frontal-impact airbag deployed;  
side-impact airbag did not deploy

SEVERITY: MAIS - 1 : ISS - 2

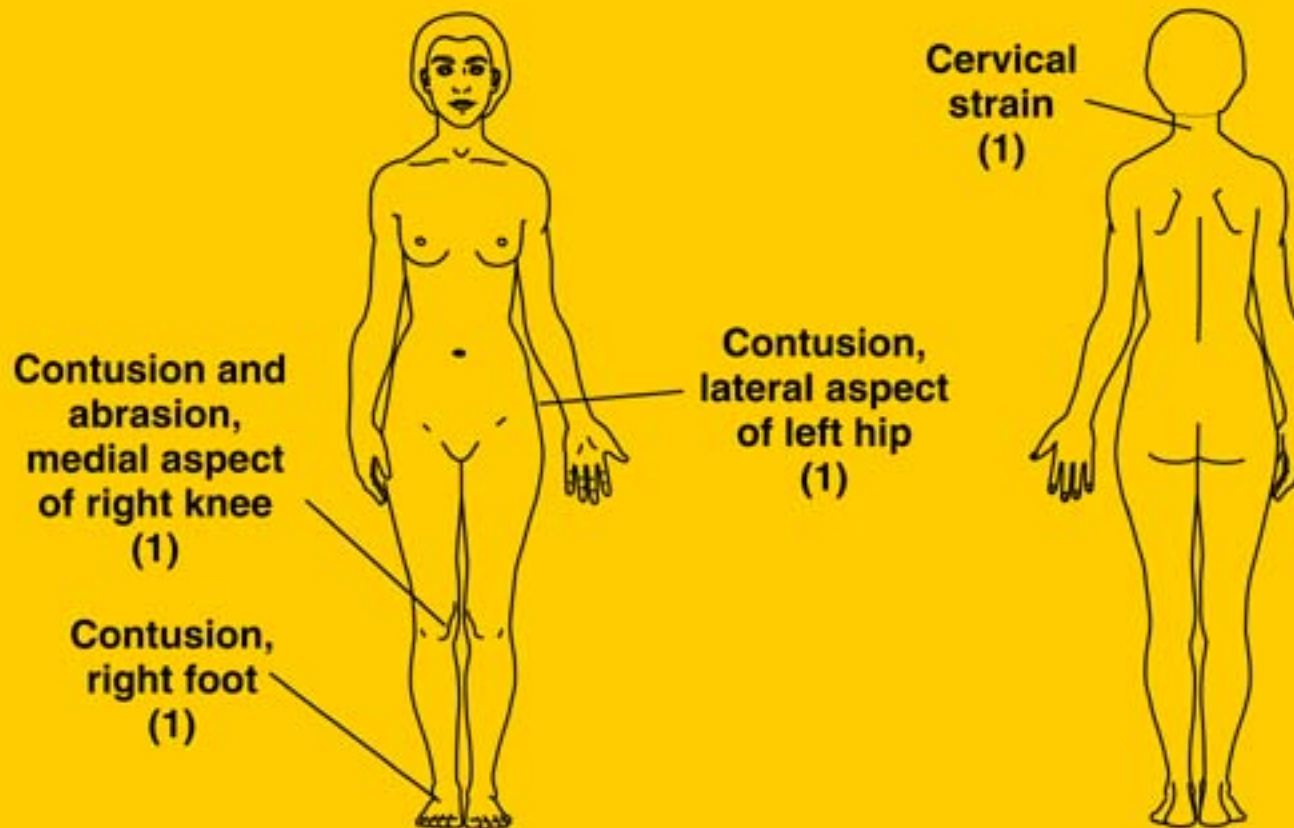

Case No.: 239-01

Case Veh. (A): 2000 Mercedes-Benz

Type: C230, 4-door sedan

Driver: 42-year-old female

Veh. (B): 1990 Eagle Talon, 2-door hatchback

Light Conditions: Daylight


Weather: Clear

Road Surface: Dry

Road Construction: Asphalt

North

Speed Limit 40 mph (64 kph)

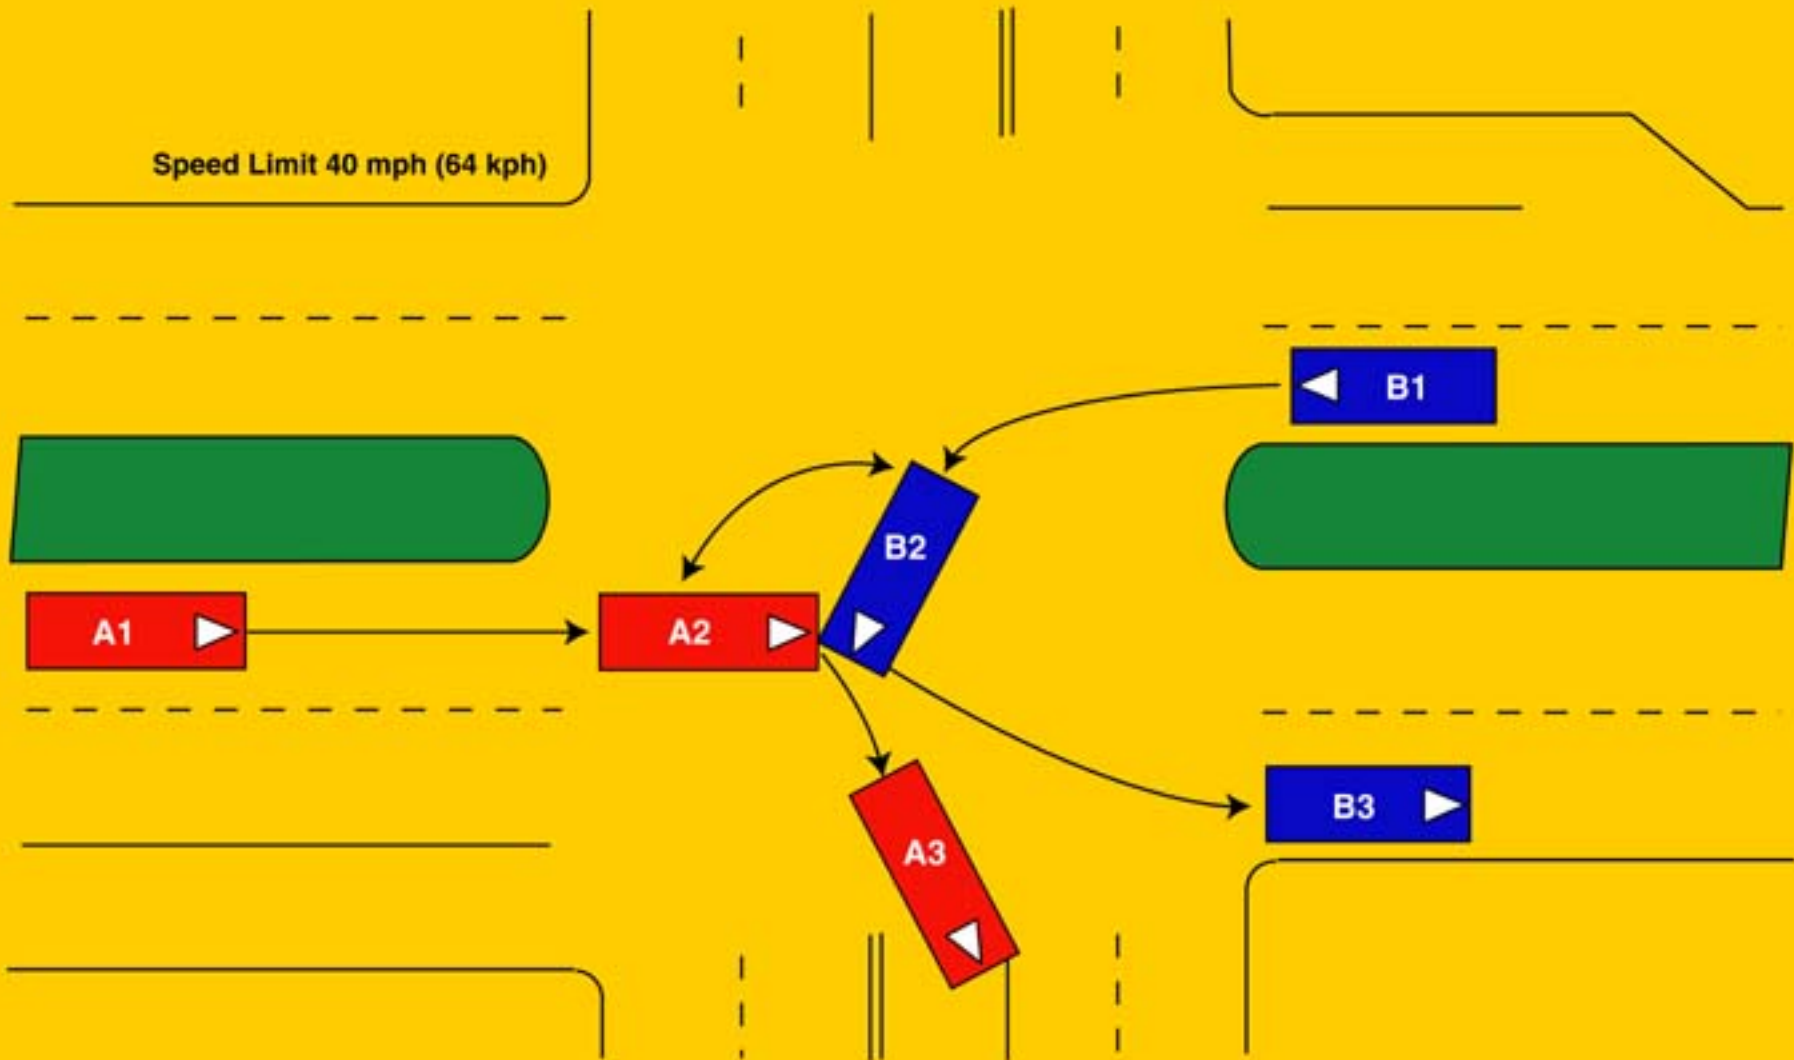

# Vehicle Report

## General

## Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	1	Urban	<a href="#">more</a>
V207 — Limited Access Highway	0	No	<a href="#">more</a>
V208 — Road Total Lanes	5	Divided, 4 lanes or more	<a href="#">more</a>
V209 — Intersecting Road Total Lanes	4	4 lanes or more	<a href="#">more</a>
V210 — Road Surface Type	1	Asphalt	<a href="#">more</a>
V211 — Road Defects	0	No	<a href="#">more</a>
V212 — Construction Zone	0	No	<a href="#">more</a>
V213 — Road Alignment Vertical Plane	1	Level	<a href="#">more</a>
V214 — Road Alignment Horizontal Plane	1	Straight	<a href="#">more</a>
V215 — Surface Covering	10	Dry	<a href="#">more</a>
V216 — Visibility Limitation	0	None	<a href="#">more</a>
V217 — Visibility Obstruction	0	None	<a href="#">more</a>
V218 — Speed Limit	3	61-70 km/h .. 40 mph	<a href="#">more</a>
V219 — Precipitation Type	0	None	<a href="#">more</a>
V220 — Precipitation Rate	8	Not applicable	<a href="#">more</a>
V221 — Temperature	2	-5 to -1 C .. 23 to 31 F	<a href="#">more</a>
V222 — Crosswind	1	Light	<a href="#">more</a>
V223 — Light Conditions	1	Daylight	<a href="#">more</a>
V224 — Mechanical Malfunction Mention	0	No	<a href="#">more</a>
V225 — Case Vehicle and Object	0	No	<a href="#">more</a>
V226 — Case Vehicle Rollover	0	No	<a href="#">more</a>
V227 — Case Vehicle Ran Off Roadway	0	No	<a href="#">more</a>



V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	<a href="#">more</a>
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	<a href="#">more</a>
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	<a href="#">more</a>
V231 — Total Vehicles Hit By Case Vehicle	1	1 vehicle	<a href="#">more</a>
V232 — Any Fire in Crash	0	No	<a href="#">more</a>
V233 — Max Police Severity-PAR	2	B - Non-Incapacitating Injury	<a href="#">more</a>
V234 — Driver Alcohol Involvement	0	Had not been drinking	<a href="#">more</a>
V235 — Driver Alcohol BAC	80	Not tested	<a href="#">more</a>
V236 — Driver Impairment Mention	0	No	<a href="#">more</a>
V237 — Driven/Towed From Scene	2	Towed Due to Damage	<a href="#">more</a>

## Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	4E3CJ44R7LE1	—	—
V302 — Other Vehicle Manufacturer/Body Code	15226	—	—
V303 — Other Vehicle Manufacturer	152	Kaiser/Jeep	<a href="#">more</a>
V304 — Other Vehicle Body Code	26	Sub-Compact 95-99.9 in. wb.	<a href="#">more</a>
V305 — Other Vehicle Make/Model	3684	Talon	<a href="#">more</a>
V306 — Other Vehicle Model Year	1990	—	—
V307 — Other Vehicle Mass	001260 kg	—	—
V308 — Other Vehicle Number	0	No separate report	<a href="#">more</a>
V309 — Other Vehicle Number of Occupants	01	—	—
V310 — Other Vehicle Traveling Speed	999	Unknown	<a href="#">more</a>
V311 — Highest Police Injury Severity	2	B - Non-Incapacitating Injury	<a href="#">more</a>
V312 — Other Vehicle Type	26	Sub-Compact 95-99.9 in. wb.	<a href="#">more</a>
V313 — Other Vehicle Wheelbase (cm)	247 cm	—	—
V314 — Average Track Width	146 cm	—	—
V315 — Overall Length	435 cm	—	—
V316 — Overall Width (OAW)	170 cm	—	—
V317 — Front Overhang (FOH)	096 cm	—	—
V318 — Rear Overhang (ROH)	092 cm	—	—
V319 — Undeformed End Width (UEW)	134 cm	—	—
V320 — Engine Displacement	3.3 <i>l</i>	—	—
V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	999	Unknown	<a href="#">more</a>
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	<a href="#">more</a>

V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	<a href="#">more</a>
--------------------------------	----	---------------------------	----------------------

## Case Vehicle

### General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	WDBHA24G4YA8	—	—
V402 — Manufacturer/Body Code	65128	—	—
V403 — Vehicle Manufacturer	651	Mercedes Benz	<a href="#">more</a>
V404 — Vehicle Body Code	28	—	—
V405 — Make/Model Code	4211	—	—
V406 — Model Year	2000	—	—
V407 — Vehicle Mass	001474 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	01	—	—
V410 — Traveling Speed	999	Unknown	<a href="#">more</a>
V411 — Body Type	14	4-door sedan	<a href="#">more</a>
V412 — Stolen Vehicle	8	Not currently collected	<a href="#">more</a>
V413 — Body Structure	2	Unitized	<a href="#">more</a>
V414 — Transmission Type	1	Automatic	<a href="#">more</a>
V415 — Transmission Lever Location	2	Console	<a href="#">more</a>
V416 — Steering	1	Power	<a href="#">more</a>
V417 — Brakes	1	Power	<a href="#">more</a>
V418 — Brake Type	3	Disc - all wheels	<a href="#">more</a>
V419 — Brake Anti-lock Device	2	Four-wheel	<a href="#">more</a>
V420 — Air Conditioning in Vehicle	8	Not currently collected	<a href="#">more</a>
V421 — Drive Type	1	Rear wheel	<a href="#">more</a>
V422 — Dual Rear Wheels	0	No	<a href="#">more</a>
V423 — Original Restraint System Type	3	Airbag	<a href="#">more</a>

V424 — Equipped With Roll Bar	0	No	<a href="#">more</a>
V425 — Roof Type	4	Sun roof closed	<a href="#">more</a>
V426 — Wheelbase	269 cm	—	—
V427 — Anti-lacerative Glass	1	Windshield	<a href="#">more</a>
V428 — Average Track Width	149 cm	—	—
V429 — Overall Length	451 cm	—	—
V430 — Overall Width (OAW)	172 cm	—	—
V431 — Front Overhang	081 cm	—	—
V432 — Rear Overhang	101 cm	—	—
V433 — Undeformed End Width (UEW)	152 cm	—	—
V434 — Engine Displacement	2.3 <i>l</i>	—	—
V435 — Engine: Number of Cylinders	04	—	—
V436 — Direct Damage Length (DDL)	125 cm	—	—
V437 — Front End Overlap % (FEO)	82	—	—
V438 — Vehicle Overlap % (VOL)	78	—	—

## Case Vehicle

## Damage

## Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	036 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V504 — Maximum Crush - Left Side	010 cm	—	—
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V507 — Are Events In Chronological Order	1	Yes	<a href="#">more</a>
V508 — Event 1 Impact Location	1	On Roadway	<a href="#">more</a>
V509 — Event 1 Impact Configuration	13	FRONT of case veh - SIDE of contacted Vehicle	<a href="#">more</a>
V510 — Event 1 Object/Vehicle Contacted	26	Sub-Compact 95-99.9 in. wb.	<a href="#">more</a>
V511 — Event 2 Impact Location	1	—	—
V512 — Event 2 Impact Configuration	23	LEFT of case veh - SIDE of cont veh (no sideswipe)	<a href="#">more</a>
V513 — Event 2 Object/Vehicle Contacted	26	Sub-Compact 95-99.9 in. wb.	<a href="#">more</a>
V514 — Event 3 Impact Location	8	No 3rd event	<a href="#">more</a>
V515 — Event 3 Impact Configuration	88	No 3rd event	<a href="#">more</a>
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V517 — Event 4 Impact Location	8	No 4th event	<a href="#">more</a>
V518 — Event 4 Impact Configuration	88	No 4th event	<a href="#">more</a>
V519 — Event 4 Object/Vehicle	00	No object/vehicle contacted	<a href="#">more</a>

Contacted			
V520 — Event 5 Impact Location	8	No 5th event	<a href="#">more</a>
V521 — Event 5 Impact Configuration	88	No 5th event	<a href="#">more</a>
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V523 — Event 6 Impact Location	8	No 6th event	<a href="#">more</a>
V524 — Event 6 Impact Configuration	88	No 6th event	<a href="#">more</a>
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V526 — Event 7 Impact On Road	8	No 7th event	<a href="#">more</a>
V527 — Event 7 Impact Configuration	88	No 7th event	<a href="#">more</a>
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V529 — Primary CDC Case Vehicle - event Number	1	Event 1	<a href="#">more</a>
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	<a href="#">more</a>
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V532 — Primary CDC Case Vehicle - crush	036	—	—
V533 — Primary CDC Case Vehicle - clock #1	12	12 o'clock	<a href="#">more</a>
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	<a href="#">more</a>
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V538 — Primary CDC Case Vehicle Extent #1	02	Extent 2	<a href="#">more</a>
V539 — Primary CDC Case Vehicle - CDC #1	12FDEW2	—	—

V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V546 — Primary CDC Case Vehicle - CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V549 — Primary CDC Contacted Vehicle -crush	999	Unknown	<a href="#">more</a>
V550 — Primary CDC Contacted Vehicle -clock #1	99	Unknown or no damage	<a href="#">more</a>
V551 — Primary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V552 — Primary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V553 — Primary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V554 — Primary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V555 — Primary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V556 — Primary CDC Contacted Vehicle -CDC #1	9900000	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>



V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V563 — Primary CDC Contacted Vehicle -CDC #2	9900000	—	—
V564 — Secondary CDC Case Vehicle - Event No	2	Event 1	<a href="#">more</a>
V565 — Secondary CDC Case Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V566 — Secondary CDC Case Vehicle - Estimated By	1	—	—
V567 — Secondary CDC Case Vehicle -crush	010	—	—
V568 — Secondary CDC Case Vehicle -clock #1	09	9 o'clock	<a href="#">more</a>
V569 — Secondary CDC Case Vehicle letter 1 #1	12	L - Left Side	<a href="#">more</a>
V570 — Secondary CDC Case Vehicle letter 2 #1	16	P - Side Center Section (Left or Right)	<a href="#">more</a>
V571 — Secondary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V572 — Secondary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V573 — Secondary CDC Case Vehicle Extent #1	02	Extent 2	<a href="#">more</a>
V574 — Secondary CDC Case Vehicle -CDC #1	09LPEW2	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>

V583 — Secondary CDC Contacted Vehicle - Estimated By	1	—	—
V584 — Secondary CDC Contacted Vehicle -crush	999	Unknown	<a href="#">more</a>
V585 — Secondary CDC Contacted Vehicle -clock #1	99	Unknown or no damage	<a href="#">more</a>
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V591 — Secondary CDC Contacted Vehicle -CDC #1	9900000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V598 — Secondary CDC Contacted Vehicle -CDC #2	9900000	—	—

## Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	999	Unknown	<a href="#">more</a>
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	9999	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	9999	—	—
V606 — Primary Impact Case Vehicle -reconstruction	12	Other Vehicle Not Inspected	<a href="#">more</a>
V607 — Primary Case Vehicle Reconstruction Mode	5	Not reconstructed	<a href="#">more</a>
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	999	Unknown	<a href="#">more</a>
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	9999	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	9999	—	—
V612 — Case Vehicle Secondary Impact Number	2	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	999	Unknown	<a href="#">more</a>
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	9999	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	9999	—	—
V617 — Secondary Case Vehicle Reconstruction Note	12	Other Vehicle Not Inspected	<a href="#">more</a>
V618 — Secondary Case Vehicle Reconstruction Mode	5	Not reconstructed	<a href="#">more</a>
V619 — Secondary Contacted Vehicle Reconstructed	999	Unknown	<a href="#">more</a>

Total Delta-V			
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	9999	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	9999	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	9999	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	028 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-028 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0005 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0049 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V630 — Primary Contacted Vehicle Reconstruction Total EBS	999	Unknown	<a href="#">more</a>
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	9999	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	9999	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	9999	—	—
V634 — Case Vehicle Secondary Impact Number	2	—	—
V635 — Secondary Case Vehicle Reconstruction Total EBS	009 kph	—	—
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	0000 kph	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	0009 kph	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	0006 kJ	—	—
V639 — Secondary Case Vehicle Reconstruction	22	Reconstructed,	<a href="#">more</a>

Note		moderate confidence level	
V640 — Secondary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	999	Unknown	<a href="#">more</a>
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	9999	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	9999	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	9999	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	125 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	036 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	141 cm	—	—
V650 — Case Vehicle Impact 1 C1	036 cm	—	—
V651 — Case Vehicle Impact 1 C2	029 cm	—	—
V652 — Case Vehicle Impact 1 C3	024 cm	—	—
V653 — Case Vehicle Impact 1 C4	017 cm	—	—
V654 — Case Vehicle Impact 1 C5	009 cm	—	—
V655 — Case Vehicle Impact 1 C6	004 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	-014 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	2	—	—
V658 — Case Vehicle Impact 2 Plane	4	Above sill	<a href="#">more</a>
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	066 cm	—	—
V660 — Case Vehicle Impact 2 Max Crush	010 cm	—	—
V661 — Case Vehicle Impact 2 Field-L	099 cm	—	—
V662 — Case Vehicle Impact 2 C1	000 cm	No Crush	<a href="#">more</a>
V663 — Case Vehicle Impact 2 C2	005 cm	—	—

V664 — Case Vehicle Impact 2 C3	010 cm	—	—
V665 — Case Vehicle Impact 2 C4	009 cm	—	—
V666 — Case Vehicle Impact 2 C5	005 cm	—	—
V667 — Case Vehicle Impact 2 C6	000 cm	No Crush	<a href="#">more</a>
V668 — Case Vehicle Impact 2 +/- D	-054 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	9	Unknown	<a href="#">more</a>
V670 — Other Vehicle Impact 1 Plane	9	Unknown	<a href="#">more</a>
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V672 — Other Vehicle Impact 1 Max Crush	999	Unknown	<a href="#">more</a>
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	<a href="#">more</a>
V674 — Other Vehicle Impact 1 C1	999	Unknown	<a href="#">more</a>
V675 — Other Vehicle Impact 1 C2	999	Unknown	<a href="#">more</a>
V676 — Other Vehicle Impact 1 C3	999	Unknown	<a href="#">more</a>
V677 — Other Vehicle Impact 1 C4	999	Unknown	<a href="#">more</a>
V678 — Other Vehicle Impact 1 C5	999	Unknown	<a href="#">more</a>
V679 — Other Vehicle Impact 1 C6	999	Unknown	<a href="#">more</a>
V680 — Other Vehicle Impact 1 +/- D	9999	—	—
V681 — Other Vehicle Reconstructed Impact Number	9	Unknown	<a href="#">more</a>
V682 — Other Vehicle Impact 2 Plane	9	Unknown	<a href="#">more</a>
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V684 — Other Vehicle Impact 2 Max Crush	999	Unknown	<a href="#">more</a>
V685 — Other Vehicle Impact 2 Field-L	999	Unknown	<a href="#">more</a>
V686 — Other Vehicle Impact 2 C1	999	Unknown	<a href="#">more</a>
V687 — Other Vehicle Impact 2 C2	999	Unknown	<a href="#">more</a>
V688 — Other Vehicle Impact 2 C3	999	Unknown	<a href="#">more</a>
V689 — Other Vehicle Impact 2 C4	999	Unknown	<a href="#">more</a>
V690 — Other Vehicle Impact 2 C5	999	Unknown	<a href="#">more</a>

V691 — Other Vehicle Impact 2 C6	999	Unknown	<a href="#">more</a>
V692 — Other Vehicle Impact 2 +/- D	9999	—	—

## Case Vehicle

### Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	0	No	<a href="#">more</a>
V702 — Right Front Wheel Damaged	0	No	<a href="#">more</a>
V703 — Right Rear Wheel Damaged	0	No	<a href="#">more</a>
V704 — Left Rear Wheel Damaged	0	No	<a href="#">more</a>
V705 — Left Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V706 — Right Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V707 — Right Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V708 — Left Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V709 — Left Front Carcass Construction	3	Radial	<a href="#">more</a>
V710 — Right Front Carcass Construction	3	Radial	<a href="#">more</a>
V711 — Right Rear Carcass Construction	3	Radial	<a href="#">more</a>
V712 — Left Rear Carcass Construction	3	Radial	<a href="#">more</a>
V717 — Left Front Tire Size	20555R16	—	—
V718 — Right Front Tire Size	20555R16	—	—
V719 — Right Rear Tire Size	20555R16	—	—
V720 — Left Rear Tire Size	20555R16	—	—



## Case Vehicle

### Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	<a href="#">more</a>
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	<a href="#">more</a>
V803 — Main Filler Cap Location	133	—	—
V804 — Main Tank Material	3	Plastic	<a href="#">more</a>
V805 — Aux Tank Type	8	Not applicable (not equipped)	<a href="#">more</a>
V806 — Aux Tank Location	888	Not applicable (not equipped)	<a href="#">more</a>
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	<a href="#">more</a>
V808 — Aux Tank Material	8	Not applicable	<a href="#">more</a>
V901 — Fuel Leakage From Crash	0	No	<a href="#">more</a>
V1001 — Fire In Or On Case Vehicle	0	No	<a href="#">more</a>

## Case Vehicle

### Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	<a href="#">more</a>
V1102 — Hood Latch Damaged	1	Yes	<a href="#">more</a>
V1103 — Hood Latch Jammed	0	No	<a href="#">more</a>
V1104 — Left Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1105 — Left Hood Hinge Separated	0	No	<a href="#">more</a>
V1106 — Right Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1107 — Right Hood Hinge Separated	0	No	<a href="#">more</a>
V1108 — Hood Remained On Vehicle	1	Yes	<a href="#">more</a>
V1109 — Rear Hood Edge Elevated	1	Yes	<a href="#">more</a>
V1110 — Edge Contacted Windshield	0	No	<a href="#">more</a>
V1111 — Edge Penetrated Windshield	8	Not applicable	<a href="#">more</a>
V1112 — Hood Latch Location	1	Front of Vehicle	<a href="#">more</a>
V1113 — Eng/Transmissn Mount Separation	0	No	<a href="#">more</a>
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	<a href="#">more</a>
V1115 — Steerng Column Coupling Damaged	9	Unknown	<a href="#">more</a>
V1116 — Steerng Column Coupling Separated	9	Unknown	<a href="#">more</a>
V1117 — Eng Comp Telescopng Unit	88	Not collected	<a href="#">more</a>
V1118 — Comp Orig/Telescopd Diff	888	Not collected	<a href="#">more</a>

V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1120 — Upper Left A-pillar Separation	0	No	<a href="#">more</a>
V1121 — Lower Left A-pillar Separation	0	No	<a href="#">more</a>
V1122 — Upper Left B-pillar Separation	0	No	<a href="#">more</a>
V1123 — Lower Left B-pillar Separation	4	No separation, but damaged	<a href="#">more</a>
V1124 — Upper Left C-pillar Separation	0	No	<a href="#">more</a>
V1125 — Lower Left C-pillar Separation	4	No separation, but damaged	<a href="#">more</a>
V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1128 — Left Front Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1129 — Left Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1130 — Left Front Door Jammed Closed	0	No	<a href="#">more</a>
V1131 — Left Rear Door Jammed Closed	1	Yes	<a href="#">more</a>
V1132 — Rear Door Type	0	No door (includes pickups)	<a href="#">more</a>
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	<a href="#">more</a>
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	<a href="#">more</a>
V1135 — Luggage Partition Damagd	0	No	<a href="#">more</a>
V1136 — Spare Tire Status	8	Not collected	<a href="#">more</a>
V1137 — Trailer Hitch Type	0	No hitch	<a href="#">more</a>
V1138 — Trailer Type	0	No trailer	<a href="#">more</a>
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>

V1140 — Upper Right A-pillar Separation	0	No	<a href="#">more</a>
V1141 — Lower Right A-pillar Separation	0	No	<a href="#">more</a>
V1142 — Upper Right B-pillar Separation	0	No	<a href="#">more</a>
V1143 — Lower Right B-pillar Separation	0	No	<a href="#">more</a>
V1144 — Upper Right C-pillar Separation	0	No	<a href="#">more</a>
V1145 — Lower Right C-pillar Separation	0	No	<a href="#">more</a>
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1148 — Right Front Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1149 — Right Rear Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1150 — Right Front Door Jammed Closed	0	No	<a href="#">more</a>
V1151 — Right Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1152 — Van Rear Door Type	8	Not applicable (not a van)	<a href="#">more</a>
V1153 — Windshield Cracked		No	<a href="#">more</a>
V1154 — Windshield Broken	8	Not applicable	<a href="#">more</a>
V1155 — Windshield Cracked or Broken by Occupant	8	Not applicable	<a href="#">more</a>
V1156 — Bond Separation Extent	0	None	<a href="#">more</a>
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	0	No	<a href="#">more</a>

## Case Vehicle

### Steering

#### Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	0	None	<a href="#">more</a>
V1202 — Number of Steering Wheel Spokes	4	4 spokes	<a href="#">more</a>
V1203 — Steering Wheel Spoke Damage	0	None	<a href="#">more</a>
V1204 — Column Tilt Feature	3	Middle	<a href="#">more</a>
V1205 — Column Swing-away Feature	0	Not equipped	<a href="#">more</a>
V1206 — Column Telescoping Feature	1	Yes, equipped	<a href="#">more</a>
V1207 — Wheel Energy Absorb Device	8	Not collected	<a href="#">more</a>
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	<a href="#">more</a>
V1209 — Column Energy Absorb Device	88	Not collected	<a href="#">more</a>
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	<a href="#">more</a>
V1211 — Shear Capsule Separation	888	Not collected	<a href="#">more</a>
V1212 — Column Vertical Rotation	0	No apparent rotation	<a href="#">more</a>
V1213 — Column Lateral Rotation	0	No apparent rotation	<a href="#">more</a>
V1214 — Steering Wheel Hub Damage	2	Airbag	<a href="#">more</a>

## Case Vehicle

### Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	0	No	<a href="#">more</a>
V1302 — Was Intrusion Catastrophic	8	Not applicable	<a href="#">more</a>
V1303 — Intrusion Number 01	00	No Intrusion, None	<a href="#">more</a>
V1304 — Intrusion 01 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1305 — Intrusion 01 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1306 — Intrusion 01 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1307 — Intrusion 01 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1313 — Intrusion 01 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1314 — Intrusion Number 02	00	No Intrusion, None	<a href="#">more</a>
V1315 — Intrusion 02 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1316 — Intrusion 02 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1317 — Intrusion 02 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1318 — Intrusion 02 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1321 — Intrusion 02 Occupant Number	00	No contact or no	<a href="#">more</a>

		intrusion	
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1324 — Intrusion 02 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1325 — Intrusion Number 03	00	No Intrusion, None	<a href="#">more</a>
V1326 — Intrusion 03 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1327 — Intrusion 03 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1328 — Intrusion 03 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1335 — Intrusion 03 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1336 — Intrusion Number 04	00	No Intrusion, None	<a href="#">more</a>
V1337 — Intrusion 04 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1338 — Intrusion 04 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1339 — Intrusion 04 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1340 — Intrusion 04 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>

V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1346 — Intrusion 04 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1347 — Intrusion Number 05	00	No Intrusion, None	<a href="#">more</a>
V1348 — Intrusion 05 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1349 — Intrusion 05 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1350 — Intrusion 05 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1357 — Intrusion 05 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1358 — Intrusion Number 06	00	No Intrusion, None	<a href="#">more</a>
V1359 — Intrusion 06 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1360 — Intrusion 06 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1361 — Intrusion 06 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>



V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1368 — Intrusion 06 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1369 — Intrusion Number 07	00	No Intrusion, None	<a href="#">more</a>
V1370 — Intrusion 07 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1371 — Intrusion 07 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1372 — Intrusion 07 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1379 — Intrusion 07 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1380 — Intrusion Number 08	00	No Intrusion, None	<a href="#">more</a>
V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>

V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1391 — Intrusion Number 09	00	No Intrusion, None	<a href="#">more</a>
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1402 — Intrusion Number 10	00	No Intrusion, None	<a href="#">more</a>
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not	<a href="#">more</a>

		collected	
V1413 — Door Intrusion Number 01	88	Not Applicable	<a href="#">more</a>
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	<a href="#">more</a>
V1415 — Door Intrusion Number 02	88	Not Applicable	<a href="#">more</a>
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	<a href="#">more</a>
V1417 — Door Intrusion Number 03	88	Not Applicable	<a href="#">more</a>
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	<a href="#">more</a>
V1419 — Door Intrusion 01 Component	88	Not Applicable	<a href="#">more</a>
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1422 — Door Intrusion 02 Component	88	Not Applicable	<a href="#">more</a>
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1425 — Door Intrusion 03 Component	88	Not Applicable	<a href="#">more</a>
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1428 — Door Intrusion 04 Component	88	Not Applicable	<a href="#">more</a>
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	<a href="#">more</a>
V1502 — Driver Airbag Deployed	1	Yes	<a href="#">more</a>
V1503 — Driver Airbag Condition	0	No Damage	<a href="#">more</a>
V1504 — Passenger Airbag Equip	1	Yes	<a href="#">more</a>
V1505 — Passenger Airbag Deployed	0	No	<a href="#">more</a>
V1506 — Passenger Airbag Condition	8	Not Applicable (not equipped/not deployed)	<a href="#">more</a>
V1507 — Steering Wheel Airbag Tether	1	Yes	<a href="#">more</a>
V1508 — Driver Airbag Marked By Contact	0	No	<a href="#">more</a>
V1509 — Passenger Airbag Tether	8	Not applicable (no airbag, not equipped, not deployed)	<a href="#">more</a>
V1510 — Passenger Airbag Marked By Contact	8	Not applicable (no airbag, not equipped, not deployed)	<a href="#">more</a>

## Case Vehicle

### Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	0	No	<a href="#">more</a>
V1602 — Right Front Door Damaged	0	No	<a href="#">more</a>
V1603 — Left Front Hardware Damaged	0	No	<a href="#">more</a>
V1604 — Right Front Hardware Damaged	0	No	<a href="#">more</a>
V1605 — Left Front Armrest Damaged	0	No	<a href="#">more</a>
V1606 — Right Front Armrest Damaged	0	No	<a href="#">more</a>
V1607 — Left Front Glass Damaged	0	No	<a href="#">more</a>
V1608 — Right Front Glass Damaged	0	No	<a href="#">more</a>
V1609 — Left Rear Door Area Damaged	0	No	<a href="#">more</a>
V1610 — Right Rear Door Area Damaged	0	No	<a href="#">more</a>
V1611 — Left Rear Hardware Damaged	0	No	<a href="#">more</a>
V1612 — Right Rear Hardware Damaged	0	No	<a href="#">more</a>
V1613 — Left Rear Armrest Damaged	0	No	<a href="#">more</a>
V1614 — Right Rear Armrest Damaged	0	No	<a href="#">more</a>
V1615 — Left Rear Glass Damaged	1	Yes	<a href="#">more</a>
V1616 — Right Rear Glass Damaged	0	No	<a href="#">more</a>
V1617 — Left Roof Side Rail Damaged	0	No	<a href="#">more</a>

V1618 — Right Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1619 — Left B-pillar Damaged	1	Yes	<a href="#">more</a>
V1620 — Right B-pillar Damaged	0	No	<a href="#">more</a>
V1621 — Left C-pillar Damaged	0	No	<a href="#">more</a>
V1622 — Right C-pillar Damaged	0	No	<a href="#">more</a>
V1623 — Left D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1624 — Right D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1625 — Left Headlining Damaged	0	No	<a href="#">more</a>
V1626 — Right Headlining Damaged	0	No	<a href="#">more</a>
V1627 — Left Roof Structure Damaged	0	No	<a href="#">more</a>
V1628 — Right Roof Structure Damaged	0	No	<a href="#">more</a>
V1629 — Left T/Sun Roof Damaged	0	No	<a href="#">more</a>
V1630 — Right T/Sun Roof Damaged	0	No	<a href="#">more</a>
V1631 — Other Left Side Item Damaged	8	Not applicable	<a href="#">more</a>
V1632 — Other Right Side Item Damaged	8	Not applicable	<a href="#">more</a>
V1633 — Foot Controls Damaged	0	No	<a href="#">more</a>
V1634 — Ignition Key Damaged	0	No	<a href="#">more</a>
V1635 — Rear View Mirror Damaged	0	No	<a href="#">more</a>
V1636 — Sunvisor/Fitting Damaged	0	No	<a href="#">more</a>
V1637 — Windshield Molding Damaged	0	No	<a href="#">more</a>
V1638 — Left A-pillar Damaged	0	No	<a href="#">more</a>
V1639 — Right A-pillar Damaged	0	No	<a href="#">more</a>
V1640 — Center Console Damaged	0	No	<a href="#">more</a>

V1641 — Transmission Lever Damaged	0	No	<a href="#">more</a>
V1642 — Horn/Spoke Shroud Damaged	1	Yes	<a href="#">more</a>
V1643 — Upper Panel Damaged	0	No	<a href="#">more</a>
V1644 — Mid Panel Damaged	0	No	<a href="#">more</a>
V1645 — Lower Panel Damaged	3	No, occupant contact	<a href="#">more</a>
V1646 — Ashtray Damaged	0	No	<a href="#">more</a>
V1647 — Control Knob/Lever Damaged	0	No	<a href="#">more</a>
V1648 — Glove Compartment Area Damaged	0	No	<a href="#">more</a>
V1649 — Instruments Damaged	0	No	<a href="#">more</a>
V1650 — Park Brake Release Damaged	0	No	<a href="#">more</a>
V1651 — Park Brake Pedal Damaged	1	Yes	<a href="#">more</a>
V1652 — A/C Or Upper Vent Damaged	0	No	<a href="#">more</a>
V1653 — Heater Or A/C Duct Damaged	0	No	<a href="#">more</a>
V1654 — Radio Damaged	0	No	<a href="#">more</a>
V1655 — Other Item Damaged	8	Not applicable	<a href="#">more</a>
V1656 — Rear Window Damaged	0	No	<a href="#">more</a>
V1657 — Rear Window Header Damaged	0	No	<a href="#">more</a>
V1658 — Vertical Console Damaged	0	No	<a href="#">more</a>
V1659 — Roof Console Damaged	0	No	<a href="#">more</a>

## Case Vehicle

### Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	<a href="#">more</a>
V1702 — Passenger Front Seat Type	05	Bucket	<a href="#">more</a>
V1703 — Driver Seat Mount Type	1	Standard	<a href="#">more</a>
V1704 — Passenger Seat Mount Type	1	Standard	<a href="#">more</a>
V1705 — Driver Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1706 — Passenger Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1707 — Driver Seat Original Equipment	1	Yes	<a href="#">more</a>
V1708 — Passenger Seat Original Equipment	1	Yes	<a href="#">more</a>
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1711 — Driver Seat Damage	0	None	<a href="#">more</a>
V1712 — Passenger Seat Damage	0	None	<a href="#">more</a>
V1713 — Center Front Armrest Damaged	0	No	<a href="#">more</a>
V1714 — Driver Seat Rotation	0	None apparent	<a href="#">more</a>
V1715 — Passenger Seat Rotation	0	None apparent	<a href="#">more</a>
V1716 — Driver Seat-back Type	3	Reclining	<a href="#">more</a>
V1717 — Passenger Seat-back Type	3	Reclining	<a href="#">more</a>
V1718 — Driver Seat-back Lock Type	3	Power	<a href="#">more</a>
V1719 — Passenger Seat-back Lock Type	3	Power	<a href="#">more</a>
V1720 — Driver Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1721 — Passenger Seat-back Lock Held	1	Yes	<a href="#">more</a>






V1722 — Driver Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1723 — Passenger Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1724 — Driver Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1725 — Passenger Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1726 — Driver Head Rest Removed	0	No	<a href="#">more</a>
V1727 — Passenger Head Rest Removed	0	No	<a href="#">more</a>
V1728 — Driver Head Rest Adjustment	2	Down	<a href="#">more</a>
V1729 — Passenger Head Rest Adjustment	2	Down	<a href="#">more</a>
V1730 — Driver Head Rest Damage	0	None	<a href="#">more</a>
V1731 — Passenger Head Rest Damage	0	None	<a href="#">more</a>
V1732 — Driver Seat Adjustment Type	2	Power	<a href="#">more</a>
V1733 — Passenger Seat Adjustment Type	2	Power	<a href="#">more</a>
V1734 — Driver Seat Adjustment Provided	7	Other	<a href="#">more</a>
V1735 — Passenger Seat Adjustment Provided	7	Other	<a href="#">more</a>
V1736 — Driver Seat Adjuster Damage	0	None	<a href="#">more</a>
V1737 — Passenger Seat Adjuster Damage	0	None	<a href="#">more</a>
V1738 — Driver Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1740 — Driver Seat Pre-crash Position	1	Forward	<a href="#">more</a>
V1741 — Passenger Seat Pre-crash Position	2	Middle	<a href="#">more</a>
V1742 — Left Rear Seat Type	6	Luggage area access panel	<a href="#">more</a>
V1743 — Right Rear Seat Type	6	Luggage area access panel	<a href="#">more</a>
V1744 — Left Rear Seat Damaged	0	None	<a href="#">more</a>
V1745 — Right Rear Seat Damaged	0	None	<a href="#">more</a>
V1746 — Center Rear Armrest Damaged	0	No	<a href="#">more</a>


V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	<a href="#">more</a>
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	<a href="#">more</a>
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	<a href="#">more</a>
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>
V1751 — Left Rear Seat-back Right Lock Equipped	0	No	<a href="#">more</a>
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	<a href="#">more</a>
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	<a href="#">more</a>
V1755 — Left 3rd Seat Equipped	0	No	<a href="#">more</a>
V1756 — Right 3rd Seat Equipped	0	No	<a href="#">more</a>
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1761 — Rear Head Restraints	1	Equipped	<a href="#">more</a>

MEASUREMENTS IN CENTIMETERS

This vehicle was not inspected.

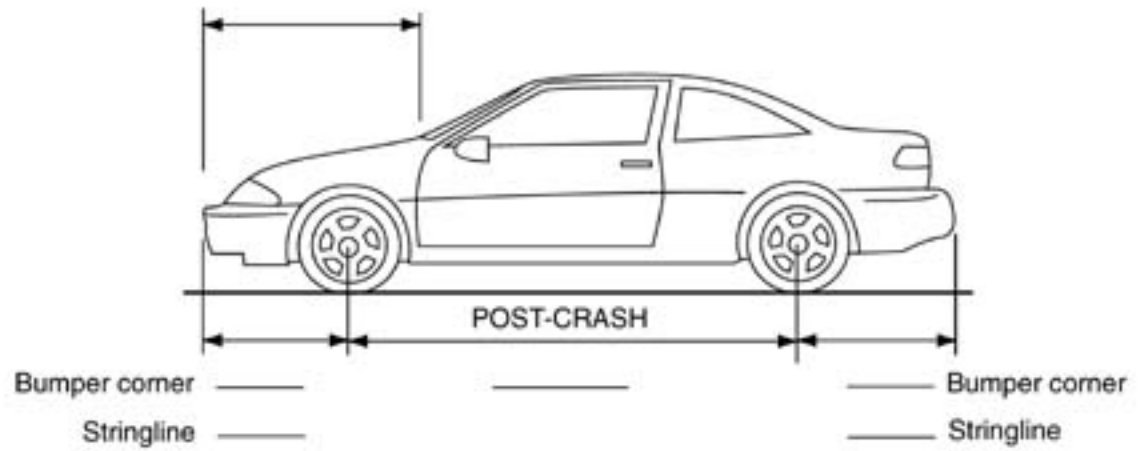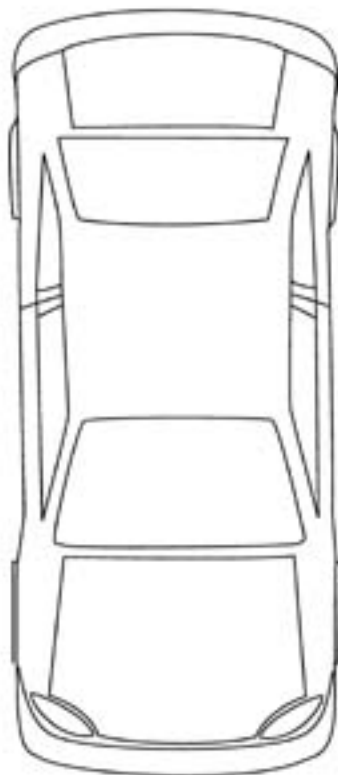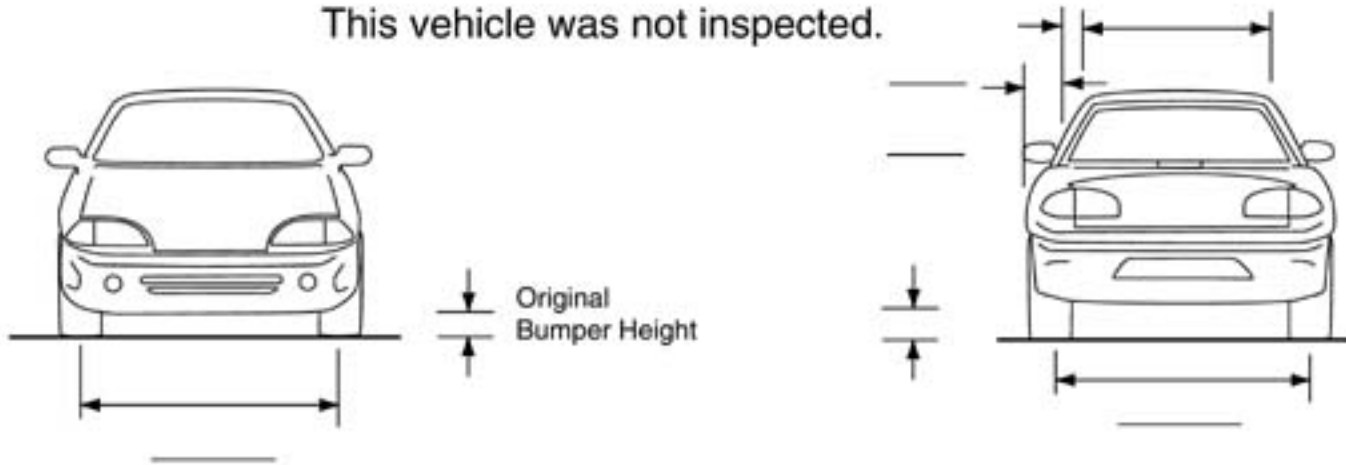


MEASUREMENTS IN CENTIMETERS

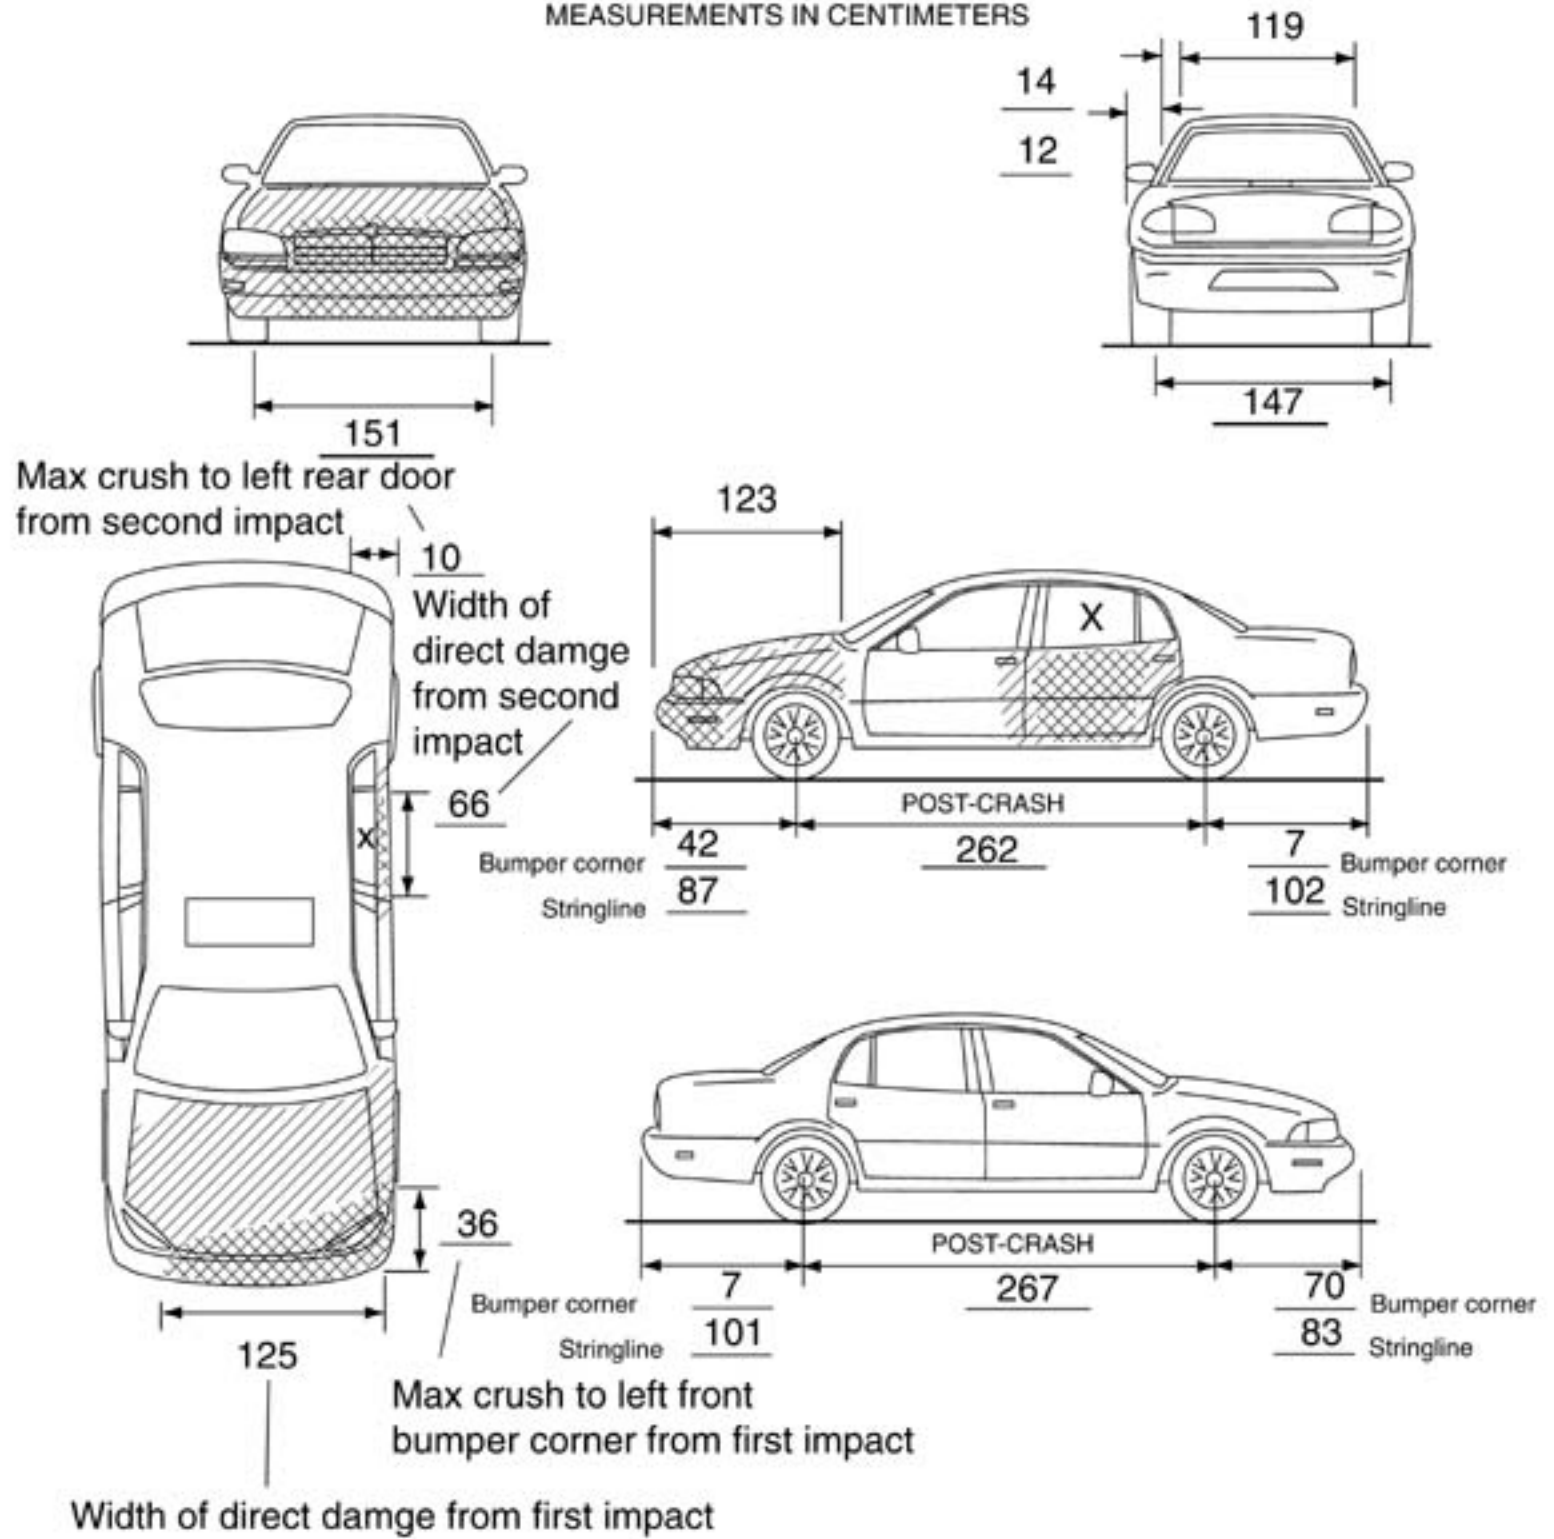

## WINDSHIELD MARK ON CASE VEHICLE:



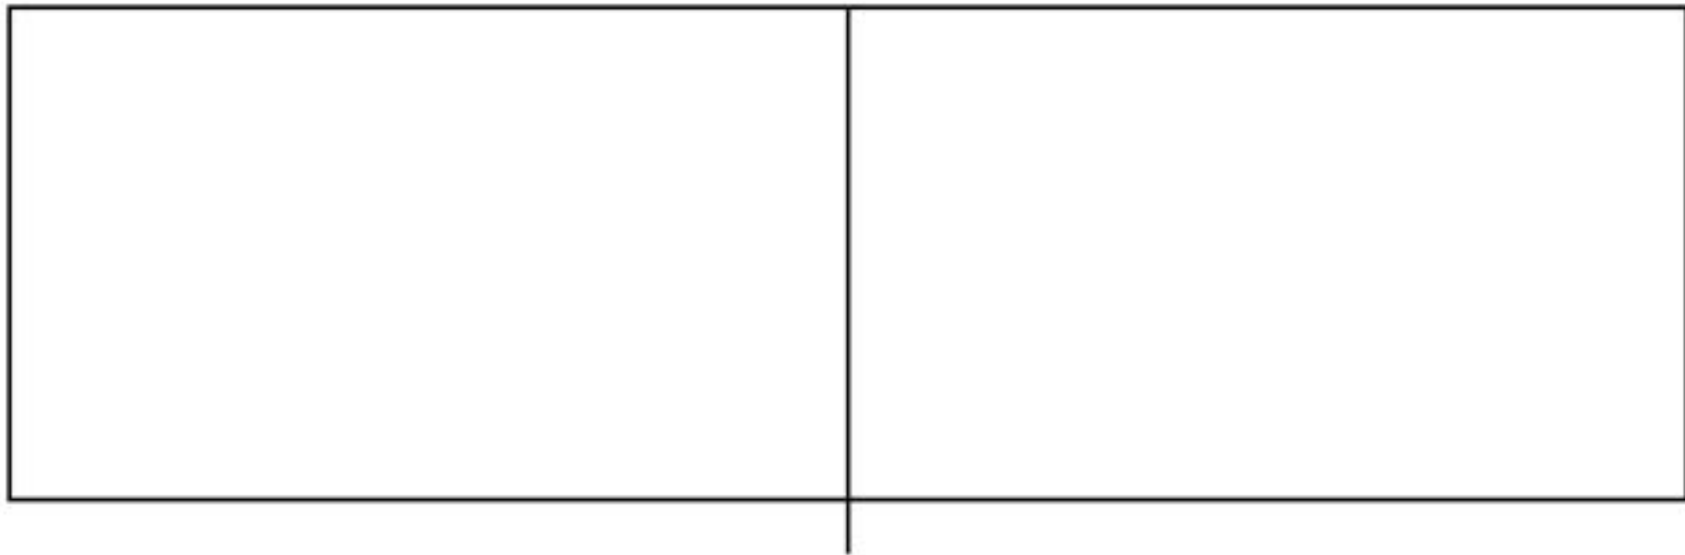


1 = Definitely 2 = Probably 3 = Possible

## INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	–	Intruded Value = Intrusion	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

## OCCUPANT CONTACT WORKSHEET


Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Knee bolster	DR	Rt. Knee	scuff mark	1
B					
C					
D					
E					
F					
G					
H					
I					
J					
K					

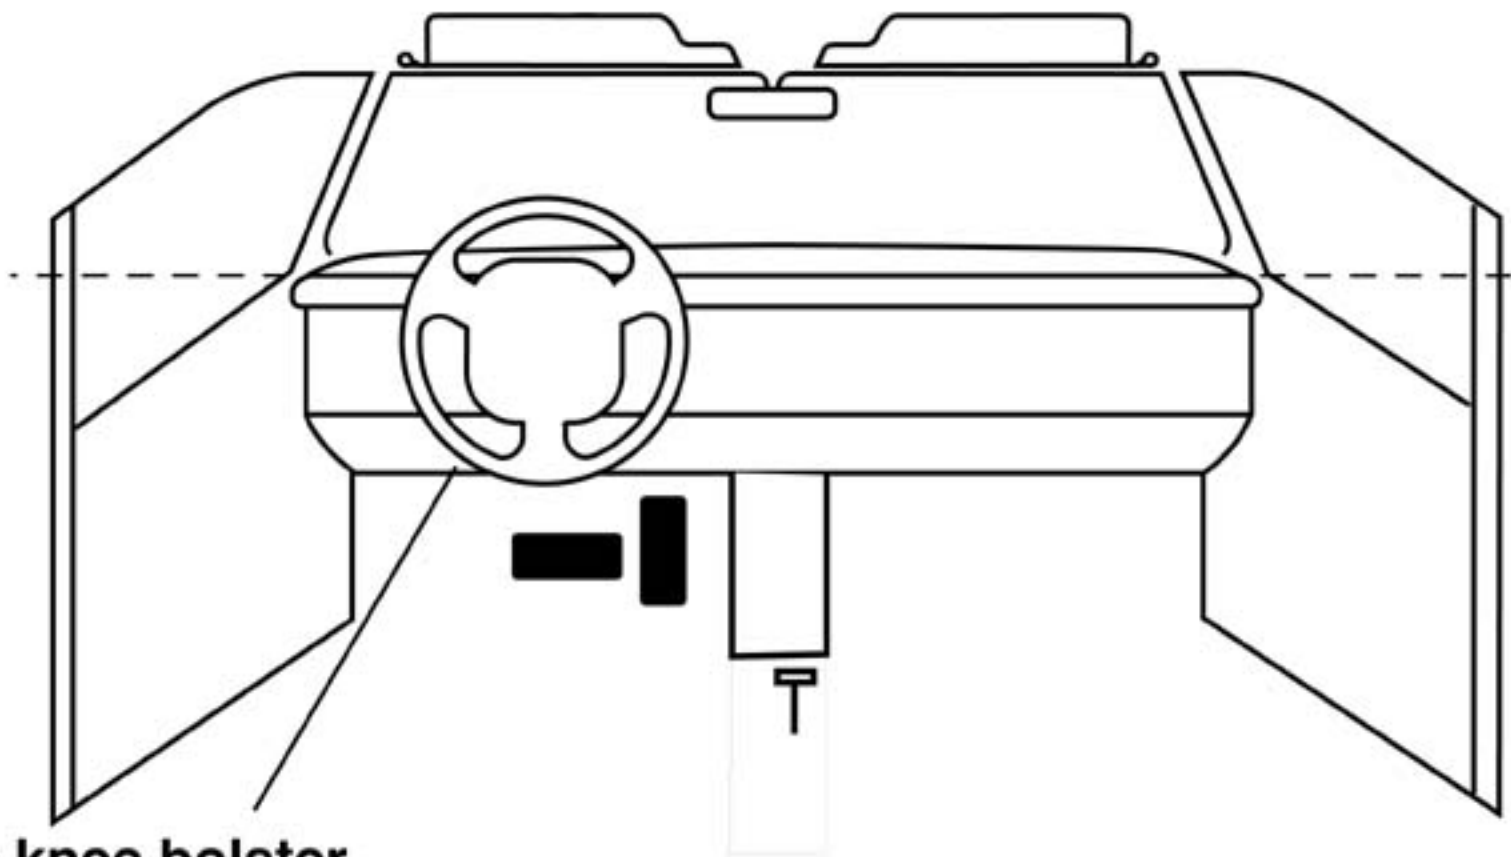


**A = knee bolster,  
scuff mark**



Driver Airbag

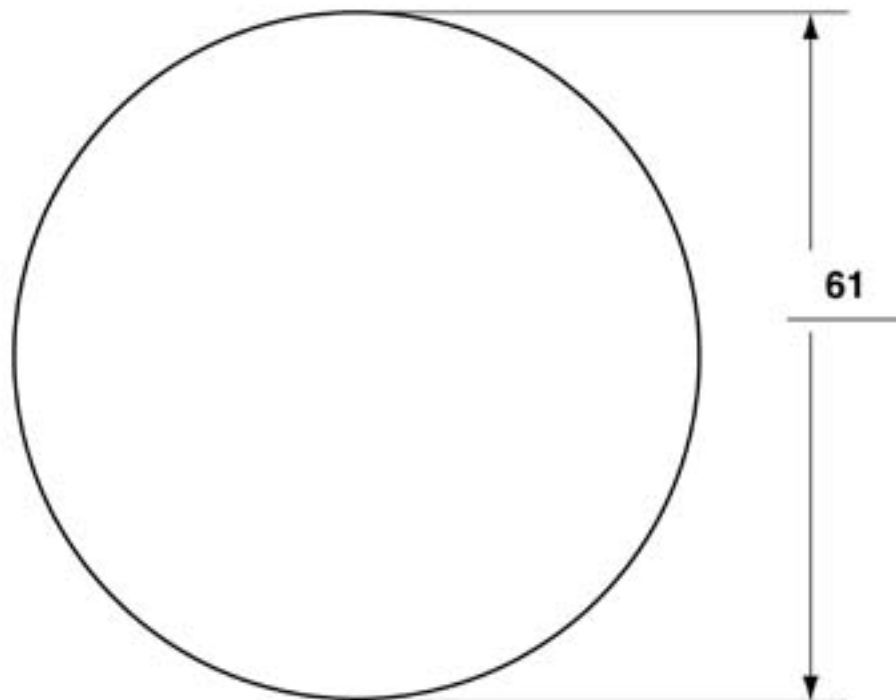

Driver Airbag Door

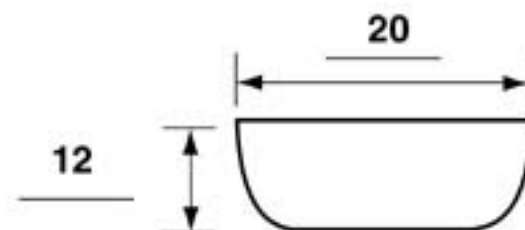


Vents: ☒ Y ☐ N  
if yes, how many: 1

at 12 o'clock


Tethers: ☒ Y ☐ N  
if yes, how many: 2

### Passenger Airbag

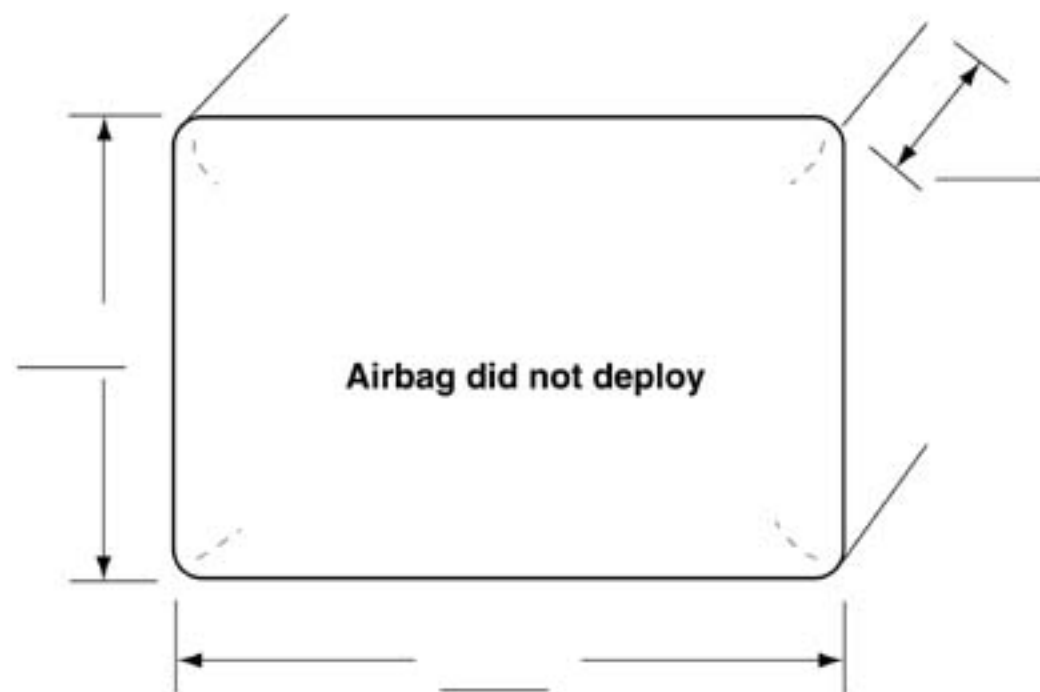

### Passenger Airbag Doors

Single Door

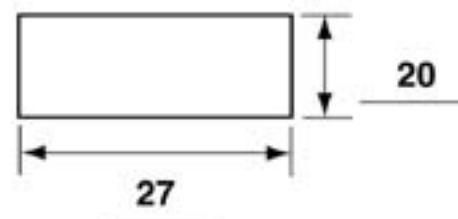

Vents: Y N

if yes, how many: \_\_\_\_\_

Tethers: Y N

if yes, how many: \_\_\_\_\_

# Case # 239: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	98	Impact force, "whiplash", hyperextension/ compression	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2104 — Primary OIC -body Region	14	Neck	<a href="#">more</a>
V2105 — Primary OIC -aspect	16	Posterior/back	<a href="#">more</a>
V2106 — Primary OIC -lesion	20	Strain	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	13	Muscles	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	NPTM1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 239: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	20	Surface of side interior	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2104 — Primary OIC -body Region	16	Pelvic/hip	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	PLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 239: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	56	Lower instrument panel	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 239: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	<a href="#">more</a>
V2102 — 1st Prob Contact Area	56	Lower instrument panel	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	01	Abrasion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KRAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 239: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	<a href="#">more</a>
V2102 — 1st Prob Contact Area	28	Foot controls (including parking brake pedal)	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	40	Floor	<a href="#">more</a>
V2104 — Primary OIC -body Region	17	Ankle/foot	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	QRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 239: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	<a href="#">more</a>
V2003 — Occupant Position -row	1	1st row	<a href="#">more</a>
V2004 — Occupant Position -lateral	1	Left	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	42	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	082 kg	—	—
V2009 — Occupant Height	155 cm	—	—
V2010 — Occupant Sex	2	Female	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	02	Treated at hospital/clinic but not admitted	<a href="#">more</a>
V2012 — Injury Severity Score	02	ISS 2	<a href="#">more</a>
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	2	B - Non-incapacitating Injury	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2017 — Passive Restraint System	1	Air bag installed	<a href="#">more</a>
V2018 — Passive Restraint Usage	2	Air bag deployed	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>



V2022 — Highest OIC Severity	1	Minor	<a href="#">more</a>
V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	0	None	<a href="#">more</a>
V2025 — Source of Occupant Info	7	Combination of above	<a href="#">more</a>





















































7956  
-P  
868190  
XKRU











rden center, Inc.  
downmouth





C 230



KOMPRRESSOR



















































**WARNING**  
Do not use this device while driving. It is illegal in many jurisdictions to use a handheld mobile phone while driving. Use of this device while driving may result in a traffic violation and/or a criminal offense. Please use common sense and responsibility when using this device. For more information, please visit [www.fda.gov](http://www.fda.gov).

**AIR BAG WARNING**  
Do not place any objects on the passenger seat or in the footwell area. This could interfere with the proper operation of the air bag system.



















040248  
798  
03 86  
TYP 278  
78 93







